



Delineation and Mapping of Groundwater Quality in Chengalpattu District of Tamil Nadu, India

**M. P. Hemavarshini ^{a*}, D. Janaki ^a, M. Baskar ^a, S. Radhika ^b
and R. Jagadeeswaran ^c**

^a Department of Soil Science and Agricultural Chemistry, ADAC & RI, Trichy, Tamil Nadu, India.

^b Department of Agronomy, ADAC & RI, Trichy, Tamil Nadu, India.

^c Department of Remote Sensing and GIS, TNAU, Coimbatore, India.

Authors' contributions

This work was carried out in collaboration among all authors. All authors read and approved the final manuscript.

Article Information

DOI: 10.9734/IJECC/2022/v12i1131107

Open Peer Review History:

This journal follows the Advanced Open Peer Review policy. Identity of the Reviewers, Editor(s) and additional Reviewers, peer review comments, different versions of the manuscript, comments of the editors, etc are available here: <https://www.sdiarticle5.com/review-history/90524>

Original Research Article

Received 17 June 2022
Accepted 05 August 2022
Published 08 August 2022

ABSTRACT

Groundwater is a major natural source of water supply all around the world. It's utilised for irrigation, industry, and even household purposes. The quality of groundwater is important for irrigation. Irrigation water quality plays a critical role in long-term soil productivity. To assess the quality of the groundwater, 149 samples were taken in May 2022 from the coastal blocks of the Chengalpattu district: Chithamur (42), Lathur (37), Thirukalukundram (31), and Thiruporur (39). The samples were analysed in accordance with the appropriate protocol. The study revealed that the coastline blocks pH ranges from 8.92 to 7.52 and their EC ranges from 11.50 to 0.13 dS m⁻¹. The Sodium Absorption Ratio (SAR) ranges from 20.00 to -6.80, while the Residual Sodium Carbonate (RSC) ranges from 14.77 to 0.26 meq/L. The Chengalpattu district has a high concentration of alkali water, according to CSSRI, Karnal classification. Among the coastal blocks, the Thiruporur block contains more alkali water compared to other coastal blocks (46%).

Keywords: Groundwater; Chengalpattu district; pH, EC, SAR, RSC.

1. INTRODUCTION

Chengalpattu district is situated on the northeast coast of Tamil Nadu. The district total area is 2944.96 square kilometers and its shoreline extends for 57 kilometers. It is situated between the longitude of 79°59' East and the latitude of 12°41' North. The major river in the Chengalpattu district is Palar which runs through the Chengalpattu district for 54 kilometres, is one of the important rivers in Tamil Nadu. It comprising of 8 taluks with 636 revenue villages and 8 blocks with 359 Village Panchayats. Acharapakkam, Chithamur, Kattankulathur, Lathur, Maduranthagam, St. Thomas Mount, Thiruporur, and Thirukalukundram are the eight blocks. Chithamur, Lathur, Thirukazhukundram, and Thiruporur are the coastal blocks in this area. Chengalpattu has a tropical wet and dry climate. The district average annual rainfall is around 1400 mm. Paddy is the most often planted crop in the area. Sugarcane is grown in several areas of the district as well. Horticulture crops like brinjal and ladies finger, watermelons and betel leaves are also grown in this area.

Water is a key component of our ecosystem without it, life on Earth cannot exist. Fresh water is a precious resource that is important for agriculture, industry, and human survival. Two-thirds of the surface of the world is covered with water. Only around 3% of the water on earth is freshwater, which is essential for all living forms; the other 97% is salt water. Groundwater is the most abundant and extensively distributed source of water in India. It is used for various purposes, including personal, commercial, and agriculture [1]. Groundwater becomes polluted with a range of pollutants, including home, agricultural, and industrial pollutants, as a result of the use of fertilizers, pesticides, and other chemical products [2]. The productivity of agriculture may be increased through irrigation. The yield is decreased when low-quality irrigation water is used for irrigation. As a result, the water's quality needs to be determined before it is used to irrigate crops [3]. Groundwater intrusion and pollution are caused by extensive groundwater extraction and increasing sea levels in coastal aquifers. To prevent seawater intrusion, restrict groundwater pumping in the affected region and install water collection systems (Pramada et al. 2018). The main issue in coastal locations is seawater intrusion, which

has a negative impact on crop growth and yield. Increased salinity in groundwater has a direct impact on plants in numerous ways, including oxidative stress, ion toxicity, nutritional imbalance, and metabolic activity changes [4,5]. Reduced plant growth, development, and yield are the results of all these issues (Sidari et al. 2008). Irrigating crops with low-quality water is detrimental to crop health and can cause salt and sodicity issues in the soil over time. Utilizing saline water reduces soil productivity by having an adverse effect on its salinity, sodicity, or toxicity. In some cases, the land may even become unusable for farming. As a result, determining the quality of groundwater is critical for recognising these issues. The objective of this study is to investigate the groundwater quality in the coastal areas of the Chengalpattu district and mapping the groundwater quality using Arc GIS software.

2. MATERIALS AND METHODS

In Chengalpattu district, 149 water samples were collected from the coastal blocks *viz.* Chithamur, Lathur, Thirukalukundram, and Thiruporur during May 2022. The location of the sample site was noted using a handheld GPS receiver (GPS, Garmin). A pre-clean plastic polyethene bottle was used to collect samples. A laboratory study was undertaken to evaluate the irrigation water quality. The samples were tested for pH, electrical conductivity, cations such as Ca^{2+} and Mg^{2+} using the versenate technique, and anions such as CO_3^{2-} , HCO_3^- , Cl^- using the Titrimetric method, and K^+ , Na^+ using Flame photometry and SO_4^{2-} using Turbidimetry using the standard procedure provided by [6]. Quality indicators such as the Residual Sodium Carbonate (RSC) and Sodium Adsorption Rate (SAR) were computed using the formula shown below.

$$\text{SAR} = \text{Na}^+ / \sqrt{(\text{Ca}^{2+} + \text{Mg}^{2+})/2}$$

$$\text{RSC} = (\text{CO}_3^{2-} + \text{HCO}_3^-) - (\text{Ca}^{2+} + \text{Mg}^{2+})$$

The central soil salinity research institute (CSSRI) in Karnal uses the EC, SAR, and RSC values to assess the appropriateness of groundwater samples for irrigation [7]. (Table 1) and the Arc GIS software version 10.1 was used to create the map of various water quality metrics in the Chengalpattu district.

Table 1. Grouping of low-quality ground waters for irrigation in India (CSSRI, Karnal classification)

Water quality	EC_{iw} (dS/m)	SAR_{iw} (m mol/L)	RSC (meq/L)
A. Good	<2	<10	<2.5
B. Saline			
i. Marginal saline	2-4	<10	<2.5
ii. Saline	>4	<10	<2.5
iii. High SAR saline	>4	>10	<2.5
C. Alkali water			
i. Marginally alkali	<4	<10	2.5-4.0
ii. Alkali	<4	<10	>4
iii. Highly alkali	Variable	>10	>4
D. Toxic water	The toxic water has variable salinity, SAR and RSC but has excess of specific ions such as chloride, sodium, nitrate, boron, fluoride or heavy metals such as selenium, cadmium, lead and arsenic etc		

3. RESULTS AND DISCUSSION

3.1 Electrochemical Properties

The study findings indicate that the pH of the groundwater sample in the blocks of Chithamur and Lathur in the Chengalpattu district respectively, in the range of 7.69 to 8.87 with a mean of 8.22 and 7.52 to 8.73 with a mean of 8.30 and the pH range in the Thirukalukundram and Thiruporur block varies from 7.78 to 8.93 with an average of 8.32 and 7.77 to 8.78 with an average of 8.32 respectively. It shows that the majority of the samples come under slightly alkaline in nature similar results were reported by (Srinivas et al. 2014).

The EC value in the Chengalpattu district coastal blocks ranges from 0.44 to 11.50 dS m⁻¹, 0.13 to 3.58 dS m⁻¹, 0.49 to 2.70 dS m⁻¹, and 0.39 to 3.94 dS m⁻¹ in Chithamur, Lathur, Thirukalukundram, and Thiruporur respectively. In the Chengalpattu district, the mean EC values are 1.50, 1.19, 1.31, and 1.31 dS m⁻¹ respectively for the Chithamur, Lathur, Thirukalukundram, and Thiruporur blocks.

The variance in EC is greater in coastal groundwater due to man-made activities such as fertiliser misuse, mineral dissolution, and saltwater intrusion [8].

3.2 Anionic Constituents of Groundwater

The range of the carbonate content in the groundwater samples taken from the coastal blocks is 2.00 to 8.00 meq L⁻¹ (Chithamur), 0.00 to 8.00 meq L⁻¹ (Lathur), 2.00 to 4.13 meq L⁻¹ (Thirukalukundram), and 2.00 to 4.00 meq L⁻¹ (Thiruporur), with a mean value of 4.19, 4.22, 4.13, and 4.00 meq L⁻¹ respectively. Groundwater has higher bicarbonate and carbonate concentrations as a result of weathering of carbonate-bearing rocks and carbonic acid dissolution in the aquifer. Mohanty et al. [9] and Venkatasalam et al. [10] both found similar findings.

The bicarbonate content of the Chithamur, Lathur, Thirukalukundram, and Thiruporur blocks ranges from 2.00 to 18.00 meq L⁻¹, 0.00 to 14.00 meq L⁻¹, 2.00 to 16.00 meq L⁻¹, and 2.00 to 24.00 meq L⁻¹, with the mean value of these blocks being 6.81, 5.78, 6.97, and 7.54 meq L⁻¹ respectively. Bicarbonate is responsible for the alkalinity of groundwater. The carbonate and bicarbonates are probably derived from weathering of silicate rocks, dissolution of

carbonate precipitates atmospheric and soil CO₂ gas [11]. Similar results were reported by Venkatasalam et al. [12] and Manoj Kumar et al. [13].

The Chengalpattu district Chithamur, Lathur, Thirukalukundram, and Thiruporur blocks had chloride levels that varied from 0.20 to 13.20 meq L⁻¹, 0.40 to 20.80 meq L⁻¹, 0.60 to 10.40 meq L⁻¹, and 0.60 to 12.20 meq L⁻¹ with corresponding means of 1.58, 2.28, 1.89, and 1.55 meq L⁻¹. The chloride ion is the most common natural form of chlorine and is particularly stable in water [14]. The high concentration of chloride in the study area is due to the mixture of seawater with groundwater [15]. Higher chloride concentrations might be caused by brines, wind-blown salt, seawater infiltration, industrial waste, and salt. Similar report was reported by [12].

The range of sulphate content in the groundwater samples were collected is 0.04 to 2.18 meq L⁻¹, -0.05 to 9.58 meq L⁻¹, 0.01 to 1.28 meq L⁻¹, and 0.04 to 6.89 meq L⁻¹ with respective mean values of 0.62, 0.73, 0.47, and 0.68 meq L⁻¹ in the blocks of Chithamur, Lathur, Thirukalukundram and Thiruporur. Sulphate levels in groundwater rise as a result of leaching and anthropogenic activities [12].

3.3 Cationic Constituents of Groundwater

Calcium levels in Chithamur, Lathur, Thirukalukundram, and Thiruporur varied from 1.20 to 6.40 meq L⁻¹, 0.20 to 8.20 meq L⁻¹, 0.40 to 10.00 meq L⁻¹, and 0.40 to 9.20 meq L⁻¹, with a mean of 2.70, 2.71, 3.08, and 2.91 meq L⁻¹. The lower concentration of Ca²⁺ in the study area, in comparison to Na²⁺ is due to cations exchange process that occurs naturally when seawater intrudes into the coastal aquifer system [15].

Magnesium levels in groundwater samples taken from the Chithamur, Lathur, Thirukalukundram, and Thiruporur blocks in the Chengalpattu district range from 0.40 to 13.80 meq L⁻¹, 0.20 to 14.00 meq L⁻¹, 0.40 to 3.21 meq L⁻¹, and 0.00 to 17.63 meq L⁻¹ with mean values of 3.78, 2.86, 3.21, and 3.63 meq L⁻¹. Similar results were reported by Manoj Kumar et al. [12]

The hardness of water is mostly determined by cations such as calcium and magnesium. The main sources of high calcium content are limestone, dolomite, and gypsum, and their breakdown causes an increase in calcium in groundwater [1].

Table 2. Mean chemical composition of groundwater in coastal blocks of Chengalpattu district

Name of the blocks	No. of samples	Range/ Mean	pH	EC (dS/m)	Ca ²⁺	Mg ²⁺	Na ⁺	K ⁺	Co ₃ ²⁻	HCO ₃ ⁻	Cl ⁻	SO ₄ ²⁻	SAR	RSC
					meq L ⁻¹								m mol/L	meq L ⁻¹
Chithamur	42	Min	7.69	0.44	1.20	0.40	0.81	0.06	2.00	2.00	0.20	0.04	-2.40	0.60
		Max	8.87	11.50	6.40	13.80	19.82	0.63	8.00	18.00	13.20	2.18	18.40	14.77
		Mean	8.22	1.50	2.70	3.78	5.98	0.13	4.19	6.81	1.58	0.62	4.52	3.56
Lathur	37	Min	7.52	0.13	0.20	0.20	0.43	0.05	0.00	0.00	0.40	-0.05	-7.20	0.26
		Max	8.73	3.58	8.20	14.00	20.74	0.90	8.00	14.00	20.80	9.58	15.20	9.88
		Mean	8.30	1.19	2.71	2.86	6.58	0.12	4.22	5.78	2.28	0.73	4.42	4.10
Thirukalukundram	31	Min	7.78	0.49	0.40	0.40	0.98	0.05	2.00	2.00	0.60	0.01	1.60	0.83
		Max	8.93	2.70	10.00	9.20	14.14	0.55	8.00	16.00	10.40	1.28	12.80	10.54
		Mean	8.32	1.31	3.08	3.21	6.56	0.15	4.13	6.97	1.89	0.47	4.81	3.77
Thiruporur	39	Min	7.77	0.39	0.40	0.00	0.80	0.06	2.00	2.00	0.60	0.04	-6.80	0.73
		Max	8.78	3.94	9.20	17.60	19.74	2.18	8.00	24.00	12.20	6.89	20.00	9.87
		Mean	8.32	1.31	2.91	3.63	6.42	0.14	4.00	7.54	1.55	0.68	5.01	3.63

The sodium content of the groundwater in the Chithamur, Lathur, Thirukalukundram, and Thiruporur blocks respectively, ranged from 0.81 to 19.82 meq L⁻¹, 0.43 to 20.74 meq L⁻¹, 0.98 to 14.14 meq L⁻¹, and 0.80 to 19.74 meq L⁻¹, with a mean of 5.98, 6.58, 6.56, and 6.42 meq L⁻¹.

The weathering of minerals containing sodium tends to raise the sodium content of water in the aquifer due to the combined effects of saltwater water mixing, halite dissolution, rock-water interaction activities, and other factors [9].

In the groundwater samples, potassium concentrations range from 0.06 to 0.63 meq L⁻¹, 0.05 to 0.90 meq L⁻¹, 0.05 to 0.55 meq L⁻¹, and 0.06 to 2.18 meq L⁻¹, with the mean value being 0.13, 0.12, 0.15 and 0.14 meq L⁻¹ in the blocks of Chithamur, Lathur, Thirukalukundram, and Thiruporur, respectively. In coastal aquifers, the weathering of clay minerals and potash feldspar raises the potassium content in the water [12].

3.4 Water Quality Parameter

SAR values range from -2.40 to 18.40, -7.20 to 15.20, 1.60 to 12.80, and -6.80 to 20.00 in

Chengalpattu district coastal blocks, with a mean of 4.52, 4.42, 4.81, and 5.01. In the Chengalpattu district. High sodium ions in water affect the permeability of the soil and cause infiltration problems and replace calcium and magnesium ions adsorbed on the clays thus causing dispersion of soil particles (Kannan et al. 2021). The rise in exchangeable sodium in the soil is caused by an increase in the SAR of irrigation water [16].

RSC values vary from 0.60 to 14.77 meq L⁻¹, 0.26 to 9.88 meq L⁻¹, 0.83 to 10.54 meq L⁻¹, and 0.73 to 9.87 meq L⁻¹, with 3.56, 4.10, 3.77, and 3.63 meq L⁻¹ as the mean. (Table 2). Higher RSC values suggest that much of the calcium and some magnesium ions precipitate from the solution, increasing the amount of sodium in water and soil particles and therefore increasing the possibility for sodium hazard (Singh et al. 2020). A high RSC may hinder air and water movement through the soil pore space, causing soil deterioration and rendering the soil unfit for irrigation [17].

Table 3. Water quality distribution (%) in coastal blocks of Chengalpattu district

S. No.	Block	No. of samples	Good	MS	MA	Alkali	HA
1	Chithamur	42	17	7	33	41	2
2	Lathur	37	11	3	46	40	-
3	Thirukalukundram	31	13	6	36	42	3
4	Thiruporur	39	15	3	36	46	-

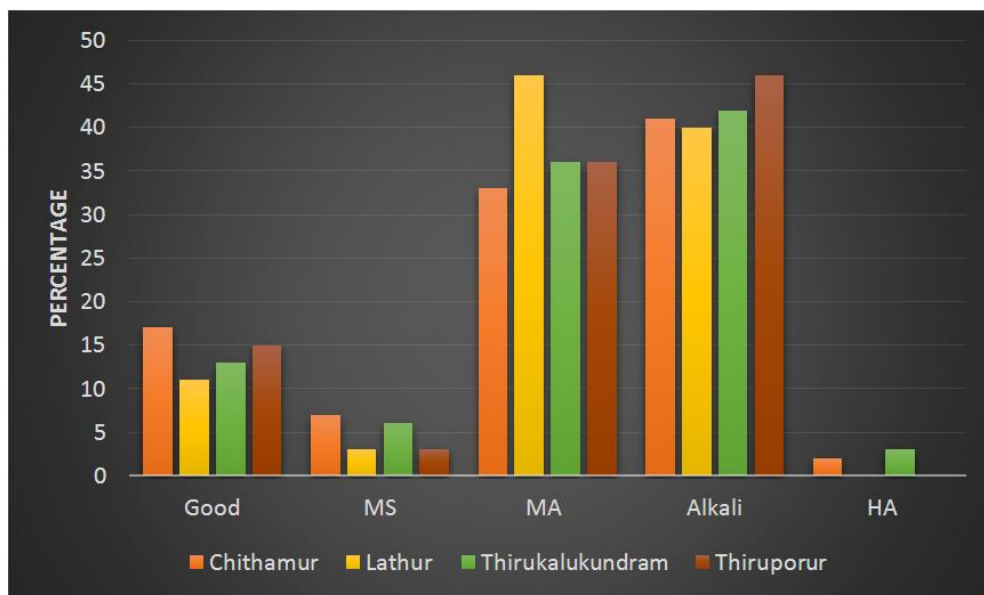


Fig. 1. Percentage distribution of different categories of water quality

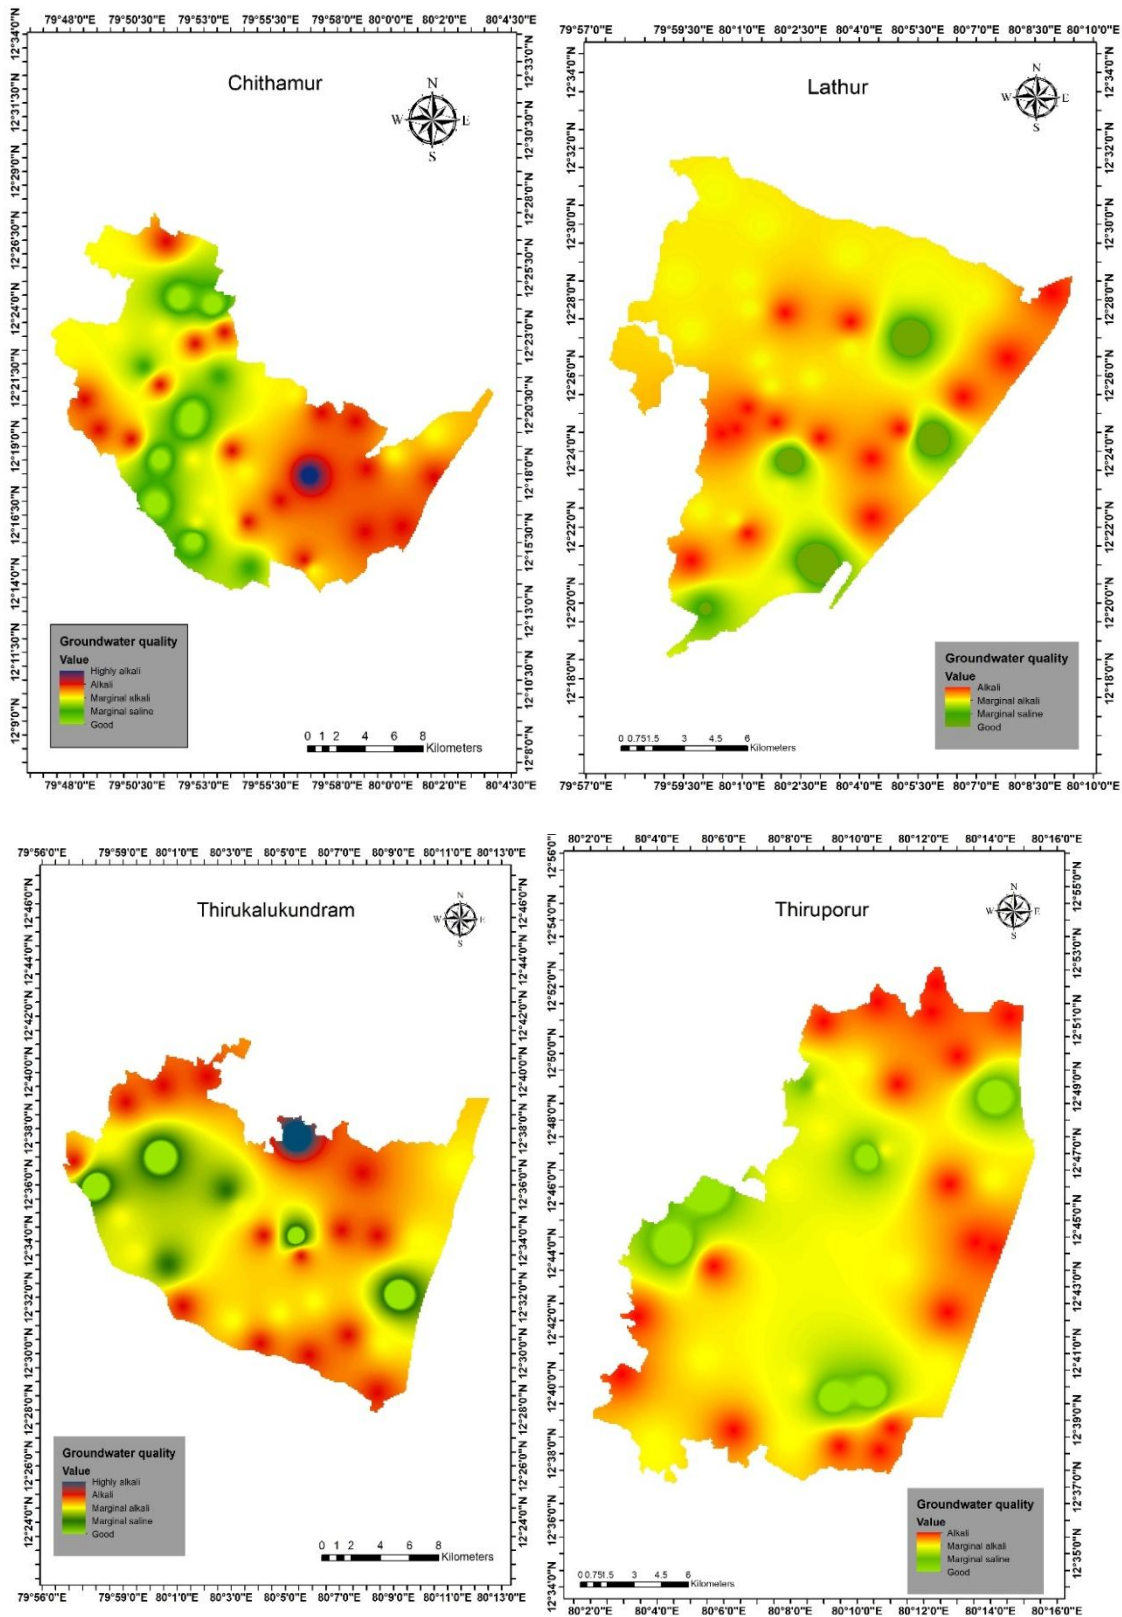


Fig. 2. Spatial distribution of different quality parameters of groundwater in coastal blocks of Chengalpattu district

3.5 Water Quality Categorization based on CSSRI, Karnal

CSSRI, Karnal classified the water quality based on the EC, SAR and RSC. According to the water quality classification, (Table 1) the coastal blocks of Chengalpattu district have good quality water at 17%, 11%, 13% and 15% in Chithamur, lathur, Thirukalukundram, and Thiruporur respectively. (Table 3 and Fig. 1).

The marginal saline (MS) was highly present in Chithamur (7%) followed by Thirukalukundram (6%) and Chithamur, Lathur (3%) blocks. Lathur block (46%) have high marginally alkali (MA) followed by Thirukalukundram, Thiruourur (36%) and Chithamur (33%).

The alkali water highly present in Thiruporur (46%) followed by Thirukalukundram (42%), Chithamur (41%) and Lathur (40%) and highly alkali (HA) present in Chithamur (2%) and Thirukalukundram (3%) blocks.

Based on the results the groundwater quality mapping was prepared by using the ArcGIS 10.1 software. The spatial distribution of different water quality parameters is presented in Fig. 2.

4. CONCLUSION

Based on the findings of this study that the Thiruporur block have high amount of alkali water (46%) compare to other blocks. Marginal alkali accounted for 46% in Lathur block followed by Thirukalukundram, Thiruporur and Chithamur. Highly alkali water was present in Chithamur (2%) and Thirukalukundram (3%) block. Chithamur block have high amount of good quality water (17%) and marginal saline (7%). Most of the samples in the Chengalpattu district area comes under alkali water and marginal saline water and this might be due to the coastal line in these blocks.

ACKNOWLEDGEMENT

We thank to the Dean ADAC&RI, Professor and Head of the Department of Soil Science and Agricultural Chemistry for their support and guidance.

COMPETING INTERESTS

Authors have declared that no competing interests exist.

REFERENCES

1. Viveka B, Arunkumar V, Vasanthi D. Assessment of Groundwater Quality in Coastal Areas of Thoothukudi District, Tamil Nadu. *Madras Agricultural Journal*. 2019;106(1-3):38-44.
2. Singh KK, Tewari G, Kumar S. Evaluation of groundwater quality for suitability of irrigation purposes: a case study in the Udham Singh Nagar, Uttarakhand. *Journal of Chemistry*. 2020:1-15.
3. Sachin HE, Singh YV, Bindu KR, Pavan D, Meena RN. Groundwater quality assessment of different villages of chikkamagalur block in Chikkamagalur district of Karnataka. *Journal of the Indian Society of Soil Science*. 2021;69(2):142-146.
4. Kumar PJ, Sajil L, Elango, James EJ. Assessment of hydrochemistry and groundwater quality in the coastal area of South Chennai, India. *Arabian Journal of Geosciences*. 2014;7(7):2641-2653
5. Rajaiah K, Naidu K, Lavanya P, Kanungo A, Murty MV, Avishek K. Assessment of Groundwater Quality Index, Suitability for Irrigation and Domestic Purposes in Krishna-Godavari Delta Region, Southern India. *Journal of Environmental Treatment Techniques*. 2021;9(4):741-750.
6. Richards LA. *Diagnosis and Improvement of Saline and Alkali Soils*. Handbook. 1954; 60.
7. AICRP. 1991. AICRP management of salt affected soil and use of saline water, CSSRI, Karnal. Progress Report:1990-1991.
8. Srinivasamoorthy K, Vasanthavigar M, Chidambaram S, Anandhan P, Sarma VS. Characterisation of groundwater chemistry in an eastern coastal area of Cuddalore district, Tamil Nadu. *Journal of the Geological Society of India* 2011; 78(6):549-558.
9. Mohanty, Atulya Kumar, Gurunadha Rao VVS.. Hydrogeochemical, seawater intrusion and oxygen isotope studies on a coastal region in the Puri District of Odisha, India. *Catena*. 2019;172:558-571.
10. Venkatasalam K, Balasubramaniam P, Gomadhiand G. Ramesh T. Assessment of groundwater quality in inland blocks of Tirunelveli District of Tamil Nadu. *IJCS* 2020;8(3):2350-2356.
11. Jeong CH. Effects of land use and urbanization on hydrochemistry and

- contamination of groundwater from Taejon area, Korea. *J Hydrol.* 2001;253:194–210
12. Manoj Kumar M, Balasubramaniam P, Gomadhi G, Ramesh T, and Jagadeeswaran.. "Groundwater quality assessment and mapping in coastal blocks of Ramanathapuram district, Tamil Nadu. *IJCS.* 2019;7(3):3185-3188.
 13. Kuttimani R, Raviraj A, Pandian BJ, Kar G. Determination of water quality index in coastal area (Nagapattinam) of Tamil Nadu, India. 2017;6(24):2208-2221.
 14. Krishna Kumar S, Chandrasekar N, Seralathan P, Prince S, Godson, Magesh NS. Hydrogeochemical study of shallow carbonate aquifers, Rameswaram Island, India. *Environmental Monitoring and Assessment.* 2012;184(7):4127-4138.
 15. Ahmad Zaharin A, Abdullah MH, Woog KK. Hydrogeochemistry of groundwater in Manukan Island Malaysia. *The Malaysian Journal of Analytical Sciences.* 2006; 11(2):407–413.
 16. Santhosh Kumar M, Balasubramaniam P, Selvamurugan M. Assessment of groundwater in mondipatti village and its surrounding area, Tiruchirapalli district, Tamil Nadu, India. *Journal of Pharmacognosy and Phytochemistry.* 2019;8:3524-3528.
 17. Kawo, Nafyad Serre, and Shankar Karuppannan. Groundwater quality assessment using water quality index and GIS technique in Modjo River Basin, central Ethiopia. *Journal of African Earth Sciences.* 2018;147:300-311

© 2022 Hemavarshini et al.; This is an Open Access article distributed under the terms of the Creative Commons Attribution License (<http://creativecommons.org/licenses/by/4.0>), which permits unrestricted use, distribution, and reproduction in any medium, provided the original work is properly cited.

Peer-review history:

The peer review history for this paper can be accessed here:
<https://www.sdiarticle5.com/review-history/90524>